

SURVEY & REMONUMENTATION

APR 25 1995

RC 1611

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

| | | |
|---------------------------------------|----------------------------------|----------------------|
| <u>WAYNE</u> (County) | Located in: City of Riverview | Corner Code # M-3 |
| 1. Public Land Survey | T <u>4S</u> R <u>10E</u> | <u>M-3</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

\$ 13.00 MISCELLANEOUS RECORDING
28 DEC 94 9:42 A.M. RECEIPT# 169
RECORDED
FOREST E. VOIRACLOD, REGISTER OF DEEDS
WAYNE COUNTY, MI

L127800PA678
Compliance with
ACT 345, P.A. 1990

APPROVED ON: 12-7-94 *DBJ*
WAYNE COUNTY REMONUMENTATION
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

RC 1611

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randy Kolehouse, in a field survey on August 4 19 94, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

| | | | | | | | | | | | | |
|----|----|----|----|----|----|----|---|---|---|---|---|---|
| | A | B | C | D | E | F | G | H | I | J | K | L |
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | |
| 3 | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | |
| 5 | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | |
| 7 | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | |
| 9 | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | |
| 11 | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | |
| 13 | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:

| | | | | |
|-----|--------|--|--------------|-----------------------|
| M-3 | 1817 | G.L.O. Notes | N/A | Post |
| | 1930's | WPA Notes | N/A | Iron |
| | 1972 | Cert. Survey L. 18107 P. 831-833 CS #198-200 | Arthurs | WCRC Mon. |
| | 1978 | Cert. Survey L. 20518 P. 85 & 86 CS #1572 | Arthurs | WCRC Mon. |
| | 1983 | Cert. Survey L. 21798 P. 80-84 CS #1823 | Ayers | Iron Pipe In Mon. Box |
| | 1987 | Cert. Survey L. 23394 P. 701 RC #896 | Sandomierski | Rerod in Monument Box |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-3 I found 5/8" rebar in monument box in C/L of Sibley (asphalt) running E-W and 10' ± W of C/L N.B. Fort Street (asphalt) which agrees with the following witnesses.

| | |
|----------------------------------|--|
| Cert. Survey CS #1572 | L.C.R.C. RS #896 |
| WCRC BM #180-190 NE'ly 47.55' | N 56° 33' E 47.50' C/L WCRC BM #180-90 |
| Cert. Survey CS #1823 | S 37° 17' E 68.35' WCRC Ref. Nail NE Side Util. Pole |
| P.K. In Util. Pole S 60° E 62.7' | N 58° 33' W 79.20' WCRC Nail NE Side Util. Pole |

Measures South to M-5 = 5299.80' (G.L.O. = 5280') (WPA = 5299.50')
Measures West to L-3 = 2579.40' (G.L.O. = 2613.60') (WPA = 2579.11' S-1 & 2577.33' S-12)
Measures North to M-2 = 2644.10' (G.L.O. = 2640') (WPA = 2643.42') (CS #198, 199, 200 = 2644.04')


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-3 Replaced 5/8" rebar with 1/2" rebar and aluminum cap stamped "Wayne Co. Remon." in an existing monument box.

Nail w/Tag "WCRC" NW Face Util. Pole N 63° E 50.07'
Nail w/Tag "WCRC" NE Face Util. Pole S 30° E 68.37'
Nail w/Tag "WCRC" NW Face Util. Pole S 73° W 75.29'
Nail w/Tag "WCRC" S Face Util. Pole N 51° W 79.29'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J. Kolehouse Date 12/14/94
Surveyor's Michigan License No. 25854

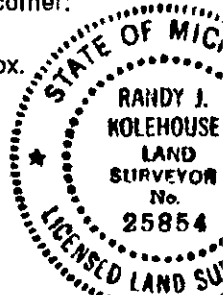

Z R D
11
MISC