

**SURVEY &
REMONUMENTATION**

MAY 10 2000

SECTION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>WEXFORD COUNTY</u>	Located In:	Corner Code #
1. Public Land Survey	T <u>21N</u> R <u>09W</u>	<u>H-7</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Richard D. Wilcox
WEXFORD COUNTY, MI
REGISTERED PROFESSIONAL SURVEYOR

1999 DEC -1 PM 3:06

RECEIVED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7								●					
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, George D. Smith, P.S., in a field survey on June, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-7) 1848 GLO Subdivision by Orson Lyon D.S. 9" Hemlock-S4E-25, 8" Hemlock-N30½E-25.
- 1880 A.J. Teed, Liber 1, Page 25. Corner found no description or witnesses given.
- 1894 A.J. Teed, Liber 1, Page 24. Corner found no description given. 36" W. Pine-S53½W-49.
- 1907 D. Teed, Liber 1, Page 26. Reset from A.J. Teed's witnesses to southwest 12" Hemlock-S88W-27½, 12" Beech-S67½E-24.
- 1908 Cavanagh, Liber 1, Page 37. Found corner no description given.
- 1962 MSHD Government monument witness record Liber 2, Page 894 by GG. Slattery. Found wood stake that fits old witness, set 3/4" pipe with boat spike in center, N38W-65.17'-12" Hemlock, S73W-41.42'-10" Maple, S66E-41.48'-8" Hemlock.
- 1963 Sageman, PS #5156. Certificate of Survey, corner found, no description or witnesses given.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- H-7) Found 5/8" iron ± 2' west of centerline north-south road, one witness from 1894 A.J. Teed Survey, and two witnesses from 1962 MSHD Government witness record. This corner is accepted as a careful and faithful perpetuation of the position of the original corner being the quarter corner common to Sections 15 and 22, T21N, R9W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- H-7) Set Wexford County brass cap stamped 15, 22, 1999, PS #39098 on existing 5/8" iron
- S76W 41.81 20" Maple
- N37W 64.02 18" Hemlock (65.17 1962 MSHD)
- N52E 41.66 Powerpole
- S62E 41.68 12" Hemlock (41.48 1962 MSHD)
- S53W 32.34 36" pine stump (1894 Teed)

Peer Group Reviewed and Approved
Date: 12 Nov 99
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

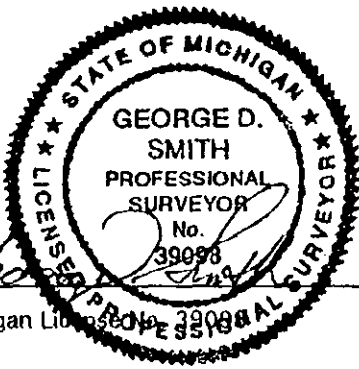

LIBER 05 PAGE 167

Signed by [Signature]
Surveyor's Michigan License No. 39098

Date 11-12-99