

SURVEY & REMONUMENTATION

MAY 10 2000

RECEIVED

1999 DEC -3 PM 12: 43

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

<u>WEXFORD</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 21N R 9W	I-9
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

I, CRAIG J. PULLEN, PS, in a field survey on October 4, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	13		17		16		15		14		13	
7												
8												
9	19		20		21		22		23		24	
10												
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

- I-9 1848 G.L.O. RESURVEY BY O. LYON, WOOD POST, HEMLOCK 20 N143/4E 8, BEECH 22 S73W 33
- 1883 A. J. TEED SURVEY IN SECTION 23, PUT IN GOOD STONE
- 1897 A. J. TEED SURVEY IN SECTION 27, FD. STONE APPLE 6 (NOT MARKED) N46½E 79
- 1902 D. E TEED SURVEY IN SECTION 22, FD. STONE IN ROAD FROM WITNESSES
- 1971 JEROME D. SWITALSKI PS#13045 SURVEY IN SECTION 26, L.247, P.305, L.C.R.C. L.1, P.56, FD. PIPE IN MONUMENT BOX IN CENTER OF INTERSECTION OF MCBAIN & N 45 RD. SPIKE IN SW SIDE 30" MAPLE S32°30'E 60.1', SPIKE IN SW SIDE 28" MAPLE S26°30'E 78.2', FACE OF FHA PROJECT MARKER N56°W 53.5', G.POLE N20°30'E 95.3'
- 1972 JERRY L. WILCOX PS#14102 SURVEY IN SECTION 26, L.248, P.910, L.C.R.C. L.1, P.109, FD. 1" IRON ROD IN MON BOX AT INTERSECTION, S20°E 26" MAPLE 60.10', N10°E P. POLE 95.16', N60°W 8" RED PINE 70.82'
- 1988 GRANGER ENGINEERING SURVEY BY J. RAY PS#25869 IN SECTION 27, FOUND 1" IRON BAR - MON. BOX, S20°E 60.10' 26" MAPLE, N10°E 55.16' P.P., N60°W 70.82' RED PINE.
- 1991 WADE-TRIM SURVEY BY JAMES A. RAY PS#25869 IN SECTION 22, FD. ½" IRON IN MON. BOX S20°E 26" MAPLE 60.10', N20°W P. POLE 60.35', N23°E T. POLE 95.40', SOUTH C/L 48 RD 0.5'
- 1994 J. DEAN GEERS PS#33977, L.C.R.C. L.4, P.221, FOUND 2" PIPE LEANING IN MON BOX IN CENTERLINE NORTH-SOUTH AND EAST-WEST ROADS SET 5/8" X 36" IRON S23°E 78.17' 36" MAPLE, N22°W 60.34' POWER POLE, N60°W 82.35' 8" SPRUCE, S20°W 119.90' POWER POLE


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- I-9 FOUND 5/8" IRON IN MONUMENT BOX 0.5' SOUTH OF CENTERLINE 48 ROAD AND 0.5' WEST OF CENTERLINE 45 ROAD AND 1971 SWITALSKI MAPLE WITNESS (78.2'). ADDED WEXFORD COUNTY BRASS CAP. THIS CORNER IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- I-9 SECTION CORNER COMMON TO SECTIONS 22, 23, 26 & 27, T21N, R9W
5/8"X36" IRON & BRASS CAP STAMPED: 1999, CJP, 39095, 22, 23, 26, & 27
S27°E 38" MAPLE 78.13'
S15°W POWER POLE 119.96'
N62°W 13" SPRUCE 82.30'
N23°W POWER POLE 60.34'

Peer Group Reviewed and Approved
Date: 12 Nov 99
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

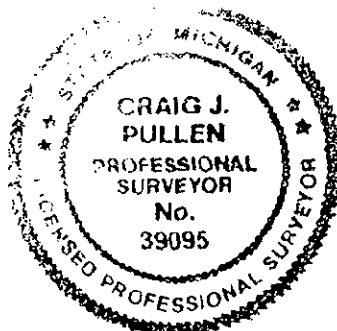

Signed by *Craig J. Pullen*

Date November 5, 1999

Surveyor's Michigan License No. 39095