

RECORDED & INDEXED

MAR 8 1 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED

1993 DEC 29 AM 9:39

For corners in

Wexford
(County)

Located In:

Corner Code ##

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

- 1. Public Land Survey T 21N R 9W M-1
 T _____ R _____
 T _____ R _____
 T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Register of Deeds Stamp & File Number

I, Richard Wilcox, in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- M-1) 1837 GLO Section post by John Brink, Deputy Surveyor, Y. Pine 24" N 28° E 29, Y. Pine 30" N 10 1/2° E 16.
 - M-1) 1958 Ostling survey: 1" pipe w/ 4" brass cap, (Liber 2, page 952)
 - M-1) 1966 Wexford Co. Road Comm.: 3/4" pipe, no witnesses given
 - M-1) 1967 Roser survey in Section 1: Found 1 1/4" pipe 18" deep over stone, raised 3/4" pipe, corner fits MSHD survey data of 1938 (proj. 83-27) SE corner concrete blk. hse., N 25° W 124.83 T. Pole, S 20° E 61.20 10" Maple, S 45° W 113.39
 - M-1) 1974 Wilcox survey in Section 1: Found 7/8" side rail pin in centerline of old M-55, N 20° W 149.70 E corner garage, N 35° W 56.80 18" Maple, N 40° E 71.12 30" Tri-Maple
 - M-1) 1974 Granger survey in Section 31, T22N, R8W: (LiberS-1, page 186)
 - M-1) From Wade Trim records: Found 2" Iron pipe 1' deep, N 35° E 62.80' Jack Pine, S 15° E 52.88' Maple, S 60° W 62.48' Y. Pine
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A. con't - (S 80° W 64.24' Y. Pine)

- M-1) 1983 Erickson survey in Section 1: Pipe in monument box (Liber 2, page 67)
- M-1) 1989 Ray survey in Section 1: Found dock spike in mon. box, SE - stop sign 29.8', SW T. Pole 111.70', SW pipeline marker 41.15 N centerline of M-55 25.9'
- M-1) 1990 Ray survey in Section 6, T21N, R8W: (Liber S-3, page 1)

Peer Group Reviewed and Approved


Date: 11-29-93

Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

- B. M-1) NE Section corner Section 1
Found dock spike in monument box 25.9' South of centerline of M-55 and in centerline of a North-South road. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-1) Set 5/8" x 36" Iron w/ Wexford Co. brass cap stamped: NE, 1, PS 33989, 1993
S 45° E - 29.80 - Stop sign
S 63° W - 111.46 - Pole
S 50° W - 41.15 - Pipeline marker
North - 25.90 - Centerline M-55
S 40° E - 67.46 - USGS monument
N 17° E - 111.24 - P. pole
N 21° W - 113.56 - Top center 18" CMP culvert

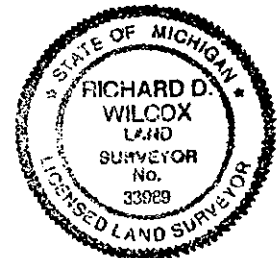

Signed by *Richard D. Wilcox* Date 11/29/93

Surveyor's Michigan License No. 33989

LIBER **004** PAGE **180**