

RECEIVED

RECEIVED

1993 DEC 29 AM 9:40

MAR 3 1 1994

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

COMMISSION

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

<u>Wexford</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>21N</u> R <u>9W</u>	<u>M-10</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Richard Wilcox, in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-10) 1838 GLO Quarter Section post by John Brink, Deputy Surveyor, Beech 16" S 53° W 19, Sugar 8" N 35 1/2° W 42
- M-10) 1899 Richardson's survey in Section 25: Sugar 6" N 63° E 32
- M-10) 1981 Milletics survey in Section 25: Liber 1, page 874, Found M.F.P. Set 1/2" Iron N 85°W 32.7' 24" Maple, N 65°E 53.85' 4" pine, S 40° E 81.20 3" Cherry

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-10) 1/4 Section corner common to Sections 25 and 30, T21N, R8W
Found 1/2" rerod in the centerline of North-South Road and ±15' North of 2-tracks to West.
This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Peer Group Reviewed and Approved

Date: 11-29-93
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-10) Set 5/8" x 36" Iron with Wexford Co. brass cap stamped: E 1/4, 25, PS 33989, 1993
N 78° W - 32.70 - 24" Maple
N 85° W - 79.62 - 26" Elm
S 44° E - 56.43 - 5" Elm
N 51° E - 53.94 - 5" Jack Pine

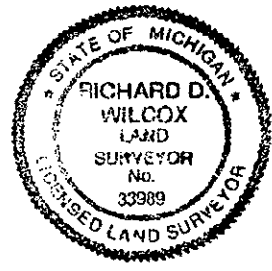

Signed by Richard D. Wilcox

Date: 11/29/93

Surveyor's Michigan License No. 33989