

SURVEY
MONUMENT

LAND CORNER RECORDATION CERTIFICATE

MAR 31 1994

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

COMM

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>21N</u> N. S., R. <u>10W</u> E. W.	<u>E-13</u>
2. PROPERTY CONTROLLING IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

RECEIVED

1993 DEC -2 PM 3:50

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, CRAIG J. PULLEN do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on SEPTEMBER 30 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

E-13 1837 ORIGINAL GOVERNMENT SURVEY BY JOHN BRINK.
WOOD POST. MAPLE 8" N38°W 9 LINKS BEECH N27°E 19 LINKS.
1990 SURVEY BY P. LEEMON, PS #31595, COR. REC. IN L.4, P.59.
SET 5"X60" CONC. MON. WITH BRASS CAP BY PROPORTIONATE MEASURE BETWEEN S¼ OF 32 AND THE SW OF 34.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E-13 LEEMON SET THIS CORNER BY SINGLE PROPORTIONATE MEASURE BETWEEN THE S¼ 32 AND THE SW 34. AFTER REVIEWING THE S¼ COR. OF 32 WITH HIM AND SUBSEQUENTLY NOT USING IT, THIS LOCATION BECAME INVALID. AFTER A CAREFUL SEARCH, NO EVIDENCE OF THE ORIGINAL CORNER OR ITS ACCESSORIES WAS FOUND. SET 5" X 5" X 60" CONCRETE MONUMENT AND BRASS CAP BY SINGLE PRORATION BETWEEN S¼ CORNER OF SECTION 33 AND NEW POSITION OF SOUTH ¼ CORNER OF SECTION 32.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-13 SE COR. COMMON TO SEC.32 AND SEC.33, T21N, R10W
SET 5"X5"X60" CONCRETE MONUMENT WITH U.S.F.S. BRASS CAP
N8°W 10" MULTIPLE SUGAR MAPLE 94.68'
N70°E 12" RED OAK 38.64'
N78°E 6" RED OAK 31.90'
S8°E 8" RED OAK 21.71'
WEST CARSONITE POST 0.5'

Peer Group Reviewed and Approved

Date: 11-29-93

Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

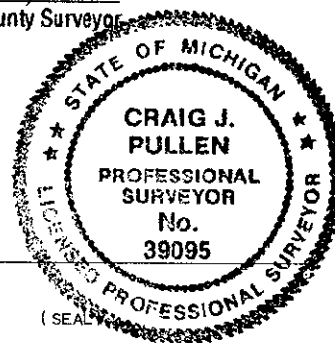

SIGNED BY Craig J. Pullen DATE 12-1-93

SURVEYOR'S MICHIGAN REGISTRATION NO. 39095

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____

APPROVED AND SIGNED BY Patricia R. Leemon DATE 11/22/93
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595