

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>22</u> N. <u>9</u> W. <u>9</u>	<u>E-2; E-3;</u>
2. PROPERTY CONTROLLING IN SECTION <u>3</u>	T. <u>22</u> N. <u>9</u> W. <u>9</u>	<u>9;</u>
3. MISCELLANEOUS PROPERTY IN SECTION <u>3</u>	T. <u>22</u> N. <u>9</u> W. <u>9</u>	<u>1753.3'E of H-2</u>
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 27, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**C. (Continued):**

E-2			E-3		
Fd. Dept. Mon. & sq. ced. post			Fd. Dept. mon. & sq. ced. post; added		
added new cedar post			new cedar post		
8" Maple	N68°W	7.99'	3" Red Pine	N14°W	23.7'
12" Red Pine stp	S12°W	32.68'	18" Twin Oak	N56°E	15.5'
9" Maple	S78°E	20.88'	4" Oak	S46°E	28.0'
6" Beech	S05°W	46.80'	4" Oak	S62°W	13.9'

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- 9 - Estab. SW cor. of Govt. Lot 1 mid-way & on line between calc. ctr. of Sec. 3 (inter. of 1/4 lines) & calc. E 1/2 cor. Sec. 3 (in Long Lake).
  - 1753.3'E of H-2 - Estab. meander cor. on E-W 1/4 line of Sec. 3 on West side of Long Lake (West side of pond on West side of Long Lake) N89°48'57"E, 1753.33' from ctr. of Sec. 3.
  - E-2 - Previous Dept. cor. (1958) (1" pipe with 4" brass cap) per Teed 1901. Teed's post was fd. which he set from Govt. B.T.s. Teed's NE wit. in good condition. Cor. falls exactly on E-W fence line.
  - E-3 - Previous Dept. cor. (1958) (1" pipe with 4" brass cap) per Teed 1901. A 1/2" pipe & old post was fd. in fence line that fit Teed NBT(stps) & Govt. B.T.(stp) SE.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- | 9   |       |       | 1753.3'E of H-2   |       |       |
|---|-------|-------|---|-------|-------|
| Drove 5/8" x 34" rerod w/RLS cap & set cedar post w/loc tag |       |       | Drove 5/8" x 34" rerod w/RLS cap & set cedar post w/loc tag |       |       |
| 4" Maple  | N44°E | 7.6'  | 16" Oak   | S45°W | 25.3' |
| 14" Oak   | N65°W | 13.3' | 4" Maple  | S02°W | 5.0'  |
| 5" Maple  | S02°W | 14.8' | 14" Oak   | S48°E | 48.8' |
- 275'± north to open grass marsh with standing water

SIGNED BY Carl F. Roser 01-24-86 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

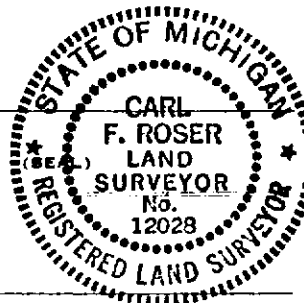

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

WEXFORD COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET