

RECEIVED

1996 DEC 10 PM 4:03

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in WEXFORD (County)

Located In:

Corner Code #

- 1. Public Land Survey T 22N R 9W B-13
2. Property Controlling in Section S T R
3. Miscellaneous Property in Section S T R

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

SURVEY &
REMONUMENTATION

MAY 20 1997

COMMISSION

Register of Deeds Stamp & File Number

- 4. Lot No. , Recorded Plat
5. Private Claims

I, CRAIG J. PULLEN, in a field survey on SEPTEMBER 26, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-M and rows 1-13. Cell 12,31 contains a black dot.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1837 ORIGINAL GLO SURVEY BY J. BRINK WOOD POST BLACK ASH 7 N22 1/2 E 32 BIRCH 10 N34W 38
1895 A.J. TEED SURVEY IN SEC.31, T22N, R9W FOUND OLD STAKE AND WIT. OK
1897 D.E. TEED SURVEY IN SEC.6, T21N, R9W HEM 8 S80 3/4 W 27 1/2 FT DISTANCE TO NW COR 2723.40' AND TO NE COR 2631.50'
1908 D.E. TEED SURVEY IN SEC.31, T22N, R9W CORNER SHOWN AS IN, AND MEASUREMENTS MADE TO IT. NO WITS GIVEN. DISTANCE TO CENTER OF SECTION IS 2640'.
1966 MICH DEPT. OF CONSERVATION SURVEY IN SEC.6, T21N, R9W BY K.J. OSTLING, PS #10068 1/2" PIPE NORTH EDGE OF BLACK TOP
1971 M. MCCLUNG, PS #13037 SURVEY IN SEC.31, T22N, R9W FOUND 1/4 CORNER DISTANCE TO CENTER OF SECTION (A FOUND CORNER) 2639.38' AND TO SE CORNER OF SECTION 2629.30'
1972 M. MCCLUNG, PS #13037 L.C.R.C., L.1, P.244 FOUND 3/4" ROD 12" TAMARACK SOUTH 40.3' POWER POLE S85E 117.50'
1986 GRANGER ENG. SURVEY IN SEC.6, T21N, R9W BY J. RAY, PS #25869 FD 1/2" IRON & CAP 0.5' N OF CENTERLINE DIVISION ROAD SOUTH 16" BALSAM 40.58' S50 W 6" TRI-OAK 94.05'
1996 MDNR SURVEY IN SEC.6, T21N, R9W BY C. KIISKILA, PS #33981 FD 1/2" REROD IN APPROX. CTR OF E-W B.TOP RD. OLD FENCE REMAINS S. ARE 29 +/- W.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


B-13 FOUND 5/8" IRON AND CAP (SMASHED) AND 2 PREVIOUS WITNESSES. REPLACED PLASTIC CAP WITH BRASS CAP. DISTANCE TO SW CORNER SECTION 31 IS 2719.50'. GLO SURVEY DISTANCE IS 2722.5'. D.E. TEED DISTANCE IS 2723.4'. DISTANCE TO SE CORNER SECTION 31 IS 2629.63' (2640'-GLO). THIS CORNER IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Peer Group Reviewed and Approved

Date: 10 Dec 96
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B-13 1/4 CORNER COMMON TO SECTION 31, T22N, R9W AND SECTION 6, T21N, R9W
5/8" IRON AND BRASS CAP STAMPED: 1/4, 31, 6, 1996, CJP, 39095
SOUTH 18" TAMARACK 40.65'
S34 W 12" OAK 54.87'
S50 W 8" TRI-OAK 94.05'
N2 E 5" WHITE PINE 52.73'

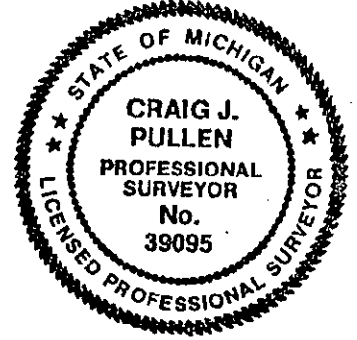

DECEMBER 10, 1996

Signed by Craig J. Pullen
Surveyor's Michigan License No. 39095

Date