

RECEIVED

1996 DEC 13 RECEIVED

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Form with fields: For corners in Wexford (County), Located In, Corner Code #, and numbered sections 1-5 for Public Land Survey, Property Controlling in Section, Miscellaneous Property in Section, Lot No., and Private Claims.

Handwritten signatures and stamps: Linda L. 1996 DEC 13 PH 3:30, WEXFORD COUNTY, MI REGISTER OF DEEDS, Linda L. 1996 DEC 13 PH 3:30, WEXFORD COUNTY REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, George D. Smith, in a field survey on August 29, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- List of survey records: J-13) 1837 GLO Quarter Section Post by John Brink, Deputy Surveyor; Hemlock 14-N61°W-15, Hemlock 14-N35°E-27; 1881 A.J. Teed Survey, Liber 1, pg. 169, Corner found no description given, Witnesses Hemlock 24-N34 1/2°W - 55, W. Pine 30-S33°W-55; 1891 A.J. Teed Survey, Liber 1, pg. 167, Corner found no description given, Witness W.Pine 31-N62 1/4°W-77; 1903 Devoc Survey, Liber 1, pg. 168, found gas pipe witnesses: Pine N62°W-77 (matches 1891 A.J. Teed Witness), Pine S33°W-55 (matches 1881 A.J. Teed Witness); 1966 MSHD Gov't Witness record, recorded in Liber 2, pg. 846 by C. Roser PS#12028, Set 1/2" Pipe between found corners East & West at 1/2 Distance; Wit's 20" T.W. Maple S41°E-69.79', 15" R. Pine N54°E-100.10, Center of M-55 North 6.44, Corner falls opposite fence line to North; 1975 MDSH R.O.W. Plans Project 83-R-2 Sheet 43, Corner is 6.44' South of Centerline, no description or witnesses given; 19?? WCRC Witness, same as C. Roser's LCRC

Continued on Back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- J-13) Found 3/4" Pipe in Mon. Box 6.5' South of Centerline M-55 and opposite fence line North. This single proportionate position matches closely within 2', with occupation of 1/4 line fence as indicated by MSHD Plan S-29-B-4 of 1938. This corner is accepted as a careful and faithful re-establishment of the position of the original corner being the 1/4 corner common to Section 35, T22N, R9W and Section 2, T21N, R9W.

SURVEY & REMONUMENTATION

MAY 20 1997


COMMISSION

Peer Group Reviewed and Approved
Date: 14 Nov 96
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J-13) Set 5/8"x36" Iron with Wexford Co. Brass Cap stamped S 1/4 35, 1996 PS#39098 on existing 3/4" pipe.

S50°E - 89.74' - 20" Red Pine
N72°E - 140.92' - P.Pole with Tag - RLS#21273
N45°W - 50.54' - Set 1/2" iron 3' North of North Edge of Bit.
S45°W - 35.16' - Set 1/2" Iron
North 6.5' - Centerline of M-55

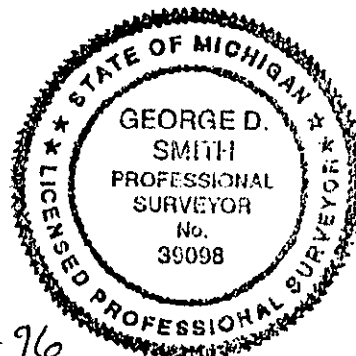

Signed by George D. Smith

Date 11-21-96

Surveyor's Michigan License No. # 39098