

RECEIVED

1993 DEC 29 AM 9:42

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Linda Longmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

For corners in

Wexford
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 22N R 9W M-10
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Richard Wilcox, in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-10) 1838 GLO Quarter Section post by John Brink, Deputy Surveyor, Y. Pine 9° N 33 1/2° W 43, Y. Pine N 65 1/2° W 39.
- M-10) 1971 Roser survey in Section 25: survey set standrad DNR mon., Liber 2, page 974, 12" Oak N 25° W 48.00, 9" Oak N 53° E 97.20, Cedar post w/ loc. tag West 33.0, Center of North-South dirt road East 9.0
- M-10) 1978 Wilcox survey in Section 25, survey in Liber 1, page 609
- M-10) 1987 Wilcox survey in Section 25, survey in Liber 66, page 527
- M-10) 1988 Wilcox survey in Section 25, survey in Liber 66, page 504
- M-10) 1990 Finnerty survey in Section 25, survey in Liber 69, page 627, DNR monument

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-10) 1/4 Section corner common to Sections 25 and 30, T22N, R8W
Found DNR monument ±7' West of centerline of a North-South road and on centerline of down fence to the West. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Peer Group Reviewed and Approved

Date: 11-29-93
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-10) Standard DNR monument on 1" pipe
N 24° W - 48.48 - 14" Oak
N 54° E - 72.03 - 8" Oak
N 88° W - 33.25 - Nail in cedar post w/ loc. tag
East ±7' - Centerline of a North-South road
S 32° E - 72.46 - 14" Oak

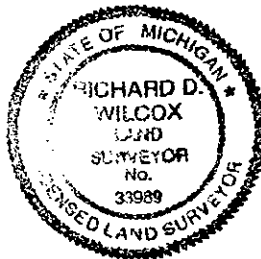

Signed by Richard D. Wilcox
Surveyor's Michigan License No. 33989

Date 11/29/93