

RECEIVED

1996 NOV -4 PM 3:38

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

For corners in
WEXFORD

(County)

Located In:

Corner Code #

Table with 4 columns: Item, T, R, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Section.

COUNTY &
REMONUMENTATION

MAY 20 1997

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, CRAIG J. PULLEN, in a field survey on AUGUST 15, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-13 1837 ORIGINAL GLO SURVEY BY J. BRINK WOOD POST HEMLOCK 13 N64E 17 MAPLE 12 S61W 09
1908 A.J. TEED SURVEY IN SECTION 6, T21N, R10W FORD AXLE HEM 10 N26E 17 1/2
1948 D.E. TEED & F. MCCLUNG SURVEY IN SECTION 1, T21N, R10W FOUND FORD AXLE AT SURFACE OF BLACKTOP HEM 20 N E 32' ELM 12 S E 62'
1958 W.C.R.C. WITNESS BOOK MONUMENT BOX 6" HEMLOCK S58°W 50.90' 15" HEMLOCK N15°E 31.70' COR. F.P. S20°E 32.00' 8" MAPLE N50°E 26.40' 10" MAPLE S60°W 42.00'
1966 MICH DEPT OF CONS. SURVEY IN SECTION 6, T21N, R9W BY K. OSTLING, PS #10068 FOUND 3/4" IRON
1972 M. MCCLUNG, PS #13037 L.C.R.C. L.1, P.244 MONUMENT BOX 22" HEMLOCK N82°E 31.3' 5" OAK N88°W 31.0' POWER POLE S42°W 20.9'
1976 J.L. WILCOX & ASSOC. SURVEY L.1, P.454 AND L.C.R.C. L.2, P.824 BY J.L. WILCOX, PS #14102 IN SECTION 36, T22N, R10W PIPE IN MON. BOX S60°W 6" HEMLOCK 50.90' N15°E 15" HEMLOCK 31.70' S20°E FE. COR. 32.00'
1981 GRANGER ENGINEERING SURVEY BY J. RAY, PS #25869 NO CORNER DESC. 2"X2" WOOD HUB NORTH 68.00' 10" MAPLE N36°E 69.50' P.POLE S40°W 41.20' 8" MAPLE SOUTH 59.60'
1996 MICHIGAN DNR SURVEY IN SECTION 6, T21N, R9W BY C. KIISKILA, PS #33981 FOUND 5/8" REROD IN MONUMENT BOX IN CENTER OF E-W B. TOP ROAD

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-13 FOUND 5/8" IRON IN MONUMENT BOX IN CENTERLINE OF DIVISION STREET AND POWER POLE WITNESS FROM 1981. ADDED BRASS CAP TO 5/8" IRON. THIS CORNER IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Peer Group Reviewed and Approved

Date: 31 Oct 96
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-13 TOWNSHIP CORNER COMMON TO SECTION 6, T21N, R9W, SECTION 1, T21N, R10W, SECTION 31, T22N, R9W, AND SECTION 36, T22N, R10W
5/8" IRON WITH BRASS CAP IN MONUMENT BOX. BRASS CAP STAMPED: 36, 31, 1, 6, 1996, CJP, 39095
N20°E 7" MAPLE 56.28'
N4°W 8" HEMLOCK 64.85'
S52°W POWER POLE 41.18'
S5°W 13" MAPLE 59.49'
S40°W NE HOUSE CORNER 68.79'

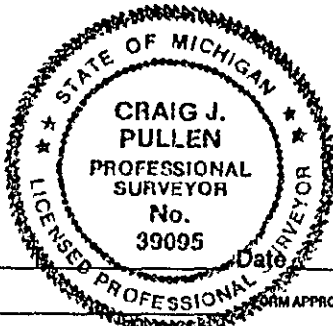

Signed by Craig J. Pullen
Surveyor's Michigan License No. 39095

OCTOBER 9, 1996