

SECTION

APR 15 1998

RECEIVED

1998 DEC 30 PM 2: 12

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

Linda Loughmiller  
WEXFORD COUNTY, MI  
REGISTER OF DEEDS

For corners in

\_\_\_\_\_ Wexford \_\_\_\_\_ Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
(County)

1. Public Land Survey T 23N R 10W \_\_\_\_\_ M-11 \_\_\_\_\_  
T \_\_\_\_\_  
T \_\_\_\_\_ *Common to:*  
T \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ *A-11 T23N, R9W* ✓  
3. Miscellaneous S \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, George D. Smith, P.S., in a field survey on April 29, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-11) 1838 GLO Section Post by John Brink, Deputy Surveyor; Sugar 12-S11W-17; Beech 10-N20½W-30
- M-11) 1852 V.W. Caukin, Deputy Surveyor; Subdivision T23N-R9W, Beech 12-N56E-34; Sugar 18-S30E-47
- M-11) 1981 J. Milletics PS# 25859 Cert. of Survey, Liber 1, Page 866. Found 1/2" iron bar, N01W 10.29' 12" Cherry, N60E 47.20' 18" Cherry, West 28.70 feet 10" Poplar.
- M-11) 1985 Mitchell PS# 28417 Cert. of Survey Liber 2, Pages 133-138. Found Wexford Co. Mon. N01W-12" Cherry-10.29 feet; N60E-18" Cherry-47.20 feet; West-10" Poplar-28.70 feet; N35W-4" Red Oak-14.92 feet
- M-11) 1988 Barnett PS 16923 Cert. of Survey Liber 67, Page 529. Found monument, no witnesses given.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Wexford Co. Mon. ± 100' easterly of trail to West and South and 1 witness from 1981 Milletics PS# 25859 Cert. of Survey and 2 witnesses from 1985 Mitchell PS# 28417 Cert. of Survey. This corner is accepted as the best available evidence of the position of the original corner being the section corner common to Sections 25 and 35 T23N-R10W and Sections 30 and 31 T23N-R9W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- Wexford Co. Mon. stamped PS 39098, 1998, NE 36
- North 10.20' 14" Cherry (Milletics 10.29')
- N35W 14.87' 6" Oak (Mitchell 14.92')
- S80W 28.86' 10" Poplar (Mitchell 28.70')
- N80E 46.85' 16" Cherry

Peer Group Reviewed and Approved

Date: 9th Dec 1998

Richard D. Wilcox  
Richard D. Wilcox, Wexford County Surveyor

Signed by George D. Smith  
Surveyor's Michigan License No. 39098

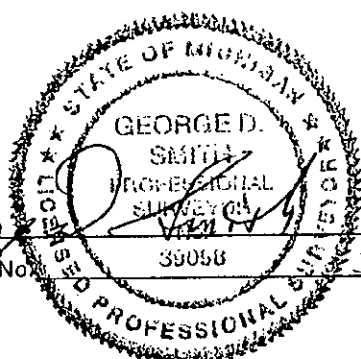

Date 12-9-98