

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
**WEXFORD**

(County)

Located In:

Corner Code #

**RECEIVED**

1996 OCT -9 PM 3: 27

*Linda Loughmiller*  
 WEXFORD COUNTY, MI  
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. Public Land Survey	T	23N	R	9W	G-13
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T		R
	S		T		R
3. Miscellaneous Property in Section	S		T		R
	S		T		R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, CRAIG J. PULLEN, in a field survey on JUNE 5, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

- G-13 1838 ORIGINAL GLO SURVEY BY J. BRINK WOOD POST BEECH 10 N20½E 41 BEECH 10 N50½W 15
- 1880 A.J. TEED SURVEY IN SEC.33, T23N, R9W CORNER SHOWN AS IN. NO WITNESSES GIVEN.
- 1958 MICH. DEPT. OF CONSERVATION SURVEY IN SEC.4, T22N, R9W, L.C.R.C. L.3 P. 23 BY K. OSTLING, PS#10068. EXCAVATED A VERY OLD STAKE POINT SUPPORTED BY STUMPS OF GOVERNMENT BT'S, POSSIBLY BY D. TEED. CHECKS FAIR TO SWAMP EDGE SOUTH AND IS ABOUT 5' SE OF POSITION OF PROPORTIONED CORNER. SET 1" PIPE WITH 4" BRASS CAP 7" B. OAK S72W 53½ LKS 20" R. PINE S20W 62 LINKS 18" R. PINE S48E 49½ LKS
- 1975 & 1984 L.C.R.C. AND SURVEY BY J. NELSON, PS #21273 L.2 P.736 AND L.1 P.306 RESPECTIVELY FOUND DNR PLAQUE AS SET BY K. OSTLING. NAIL & TAG NW SIDE 24" R. PINE AZ 137° 33.45' NAIL & TAG WEST SIDE 24" R. PINE AZ 200° 41.71' NAIL & TAG NORTH SIDE 30" B. OAK AZ 272° 8.68' NAIL & TAG NE SIDE 4" R. PINE AZ 340° 11.63'
- 1991 J. ERICKSON, PS #16929 L.C.R.C. L.4 P.140 FOUND DNR MON. 6" ABOVE GROUND N85°W 8.81' 24" OAK N15°W 11.58' 4" R. PINE S72°E 40.04' 15" OAK S40°E 33.52' 22" R. PINE
- 1994 J. CARTER, PS #33973 L.C.R.C. L.4 P. 232 FOUND DNR MONUMENT N85°W 8.82' MDOT NAIL & TAG IN 24" OAK S15°W 41.56' RLS TAG IN 23" R. PINE S44°E 33.45' RLS TAG IN 23" R. PINE S73°E 40.05' MDOT NAIL & TAG IN 15" OAK N15°W 11.62' RLS TAG IN 5" R. PINE

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

G-13 FOUND 1" PIPE WITH ALUMINUM CAP (DNR) IN EXCELLENT CONDITION AND 5 PREVIOUS WITNESSES. THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

SURVEY &  
 REMONUMENTATION

MAY 29 1997


Peer Group Reviewed and Approved

Date: 26 Sep 96

*Richard D. Wilcox*  
 Richard D. Wilcox, Wexford County Surveyor

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- G-13 SECTION CORNER COMMON TO SECTIONS 33 AND 34, T23N, R9W, AND SECTIONS 3 & 4, T22N, R9W
- 1" PIPE AND ALUMINUM DNR CAP
- N85°W 24" OAK 8.82'
- S15°W 23" RED PINE 41.56'
- S44°E 23" RED PINE 33.45'
- N15°W 5" RED PINE 11.64'
- S73°E 15" OAK 40.05'

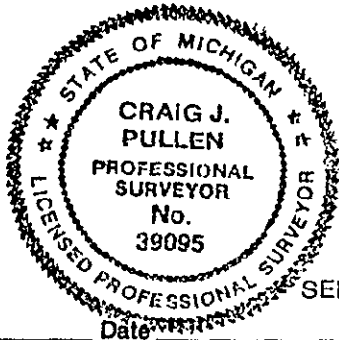

Signed by Craig J. Pullen  
 Surveyor's Michigan License No. 39095

SEPTEMBER 9, 1996