

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 9 W.	B-9; B-10; B-11
2. PROPERTY CONTROLLING IN SECTION 30	T. 24 N. R. 9 W.	1
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 6, 1980, established re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~\* = Description of original monument and accessories and for subsequent restoration \*~~

C. (continued)

1  
Drove 1"x18" solid iron rod  
13" Tamarack N30°E 59.29  
11" Tamarack Due N 88.68  
12" Cedar S55°W 60.00  
Set ced.post w/loc. tag South 31'  
Ctr. E-W b'top road North 2.3'

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- B-9 Reset N¼ corner Sec. 30 from 1972 Wexford Co. Road Comm. witnesses.
  - B-10 Established center Sec. 30 at intersection of one-quarter lines.
  - B-11 Fd. & accepted 1" pipe for S¼ corner Sec. 30. Corner is 2'± S of approx. center of E-W gravel road & in line with N-S fence to N & S.
- 1 Established W 1/8 corner on N line Sec. 30 at proportionate measure to U.S. (GLO plat). Old N-S fence to S is 52'± W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-9	B-10	B-11
Set Wexford Co. Monument	Set 3/4"x7' pipe (1' above grnd) w/RLS cap & ced.post w/loc. tag	Fd. 1"x12" pipe; repl. w/Wexford Co. Mon.
10" Cedar N10°E 64.20	11" Cedar N54°W 25.0	6" Cedar N15°W 69.31
2" Pipe S05°W 30.10	9" Maple N82°E 31.4	9" Twn. Maple N20°E 35.93
9" W. Pine S30°W 92.70	10" Cedar S14°W 21.2	9" Cedar S45°W 41.29
Set cedar post w/loc. tag South 30'		Set ced.post w/loc. tag North 33'
Ctr. E-W b'top road North 2.1'		Ctr. E-W gravel road North 2'±

SIGNED BY Carl F. Roser DATE 7-23-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

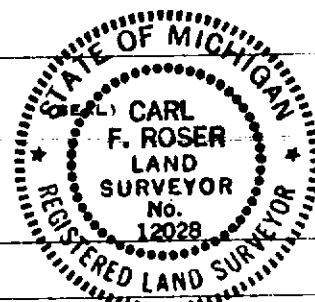

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ LIBERTY TOWNSHIP  
WEXFORD COUNTY