

APR 16 1999

RECEIVED

1998 DEC 30 PM 2: 11

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Linda Loughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

For corners in

Wexford (County) Located In: Corner Code #
1. Public Land Survey T 24N R 09W M-6
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Table with 13 rows and 13 columns (A-M) containing numbers 1-36 in a grid pattern.

I, George D. Smith, P.S., in a field survey on May 18, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-6) 1837 GLO Quarter Section Post by John Brink, Deputy Surveyor. Hemlock 10-S19 1/2 W-12 Cedar N31 1/2 W-27
M-6) 1913 Fargo Engineering Co. found no US evidence set corner at proportionate measure. White Pine stump 40"-S68 1/2 E-0.75, Cedar Stump 18"-N13 1/2 W-0.47 1/2


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found pipe (laying down) and butterdish along with 2 witnesses from 1913 Fargo Survey. Set 5/8" x 36" iron with Wexford County brass cap stamped E 1/4 13 PS 39098, 1998 at location of butterdish. This corner is accepted as a careful and faithful re-establishment of the position of the original corner being the quarter corner common to Section 13, T24N-R9W and Section 18, T24N-R8W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 5/8" x 36" iron with Wexford County Brass Cap stamped E 1/4 13, 1998, PS 39098
N68W 30.50' 18" Cedar stump (31.35 Fargo)
S70E 50.3' 18" W. Pine stump (49.5 Fargo)
N50W 17.41' 5" Oak
S20W 8.10' 12" Maple
S65E 14.18' 36" Maple
N85E 15.32' 10" Maple

Peer Group Reviewed and Approved
Date: December 1998
Richard D. Wilcox, Wexford County Surveyor

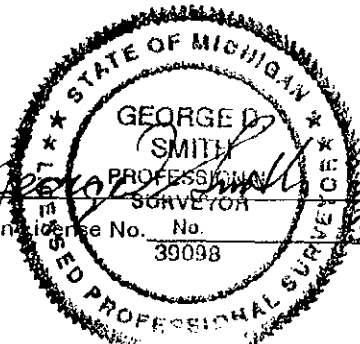

Signed by [Signature]
Surveyor's Michigan License No. 39098

Date 12-9-98