


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Wexford (County)	Located In	Corner Code #
1. Public Land Survey	T 24N R 9W	G2
2. Property Controlling in Section	S T R	_____
3. Miscellaneous Property in Section	S T R	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

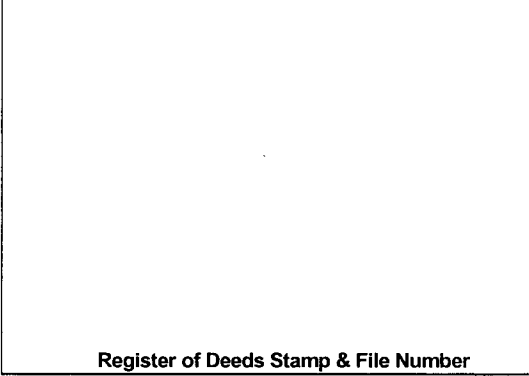

I, Craig W. McVean, in a field survey on June 12, 2006 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5			4	●	3		2		1	
3													
4	7		8			9		10		11		12	
5													
6	18		17			16		15		14		13	
7													
8	19		20			21		22		23		24	
9													
10	30		29			28		27		26		25	
11													
12	31		32			33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

- G2 – 1852 – GLO – V. W. Caukins – Set ¼ post
- 1) Tamarack 12" N24°E 15 L.
 - 2) Tamarack 7" S55°W 19 L.
- 1975 – LCRC L. 2, p. 754 – C. F. Roser – Set Wexford County Monument and cedar post on line between Section corners N & S and at prorated distance to US meander.
- 3) 15" Cedar S44°E 22.7'
 - 4) 10" Cedar S02°W 33.2'
 - 5) 9" Cedar North 67.0'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

G2 – ¼ Corner common to Sections 3 & 4, T24N, R9W - Found 4" Wexford County Aluminum Cap Monument in Cedar swamp, loose and heaved up. Pushed back down and plumb to fit found C.F. Roser wits. Added sand around monument and stamped cap "¼ S4|S3". No GLO evidence found. South 44' to edge of swamp ±20'. Measured Grid Distances N2°24'25"E 2846.80' (2853.18' – GLO, 2847.39' – C. F. Roser) to "G1" and S2°24'33"W 2639.39' (2645.28' – GLO, 2639.91' – C. F. Roser) to "G3". Wexford County monument at single proportional position to GLO between "G3" and "G1" and is accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- G2 – 4" Wexford County Aluminum Cap monument
- N39°E 6.19' to set Nail & Tag (N & T) in SE side 8" R. Maple scribed 'XBT'
 - S46°E 23.33' to set N & T in SW side 19" Cedar (#3)
 - S01°E 33.71' to set N & T in E. side 14" Cedar (#4)
 - S63°W 44.97' to set N & T in SE side 8" Cedar scribed 'XBT'
 - N02°W 67.17' to set N & T in W. side 12" Cedar (#5)
 - Set Blue Carsonite post with location tag 1' North



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 3/15/2007