

**SURVEY &
REMONUMENTATION**

APR 25 1995

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

RECEIVED

1994 NOV 23 PM 3:54

Linda Longmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

For corners in

Wexford
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---------------------------|-------------|
| 1. Public Land Survey | T <u>24N</u> R <u>10W</u> | <u>H-13</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	6	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, George D. Smith, in a field survey on July 12, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-13) 1838 GLO Quarter Section post by John Brink, Deputy Surveyor, Sugar 9 N 18 1/2° E 38, Sugar 12 N 24° W 17
- H-13) A.J. Teed, Liber 1, page 282, survey in Section 3, T23N, R10W, one witness ok, set stake and stone Sugar 4 N 62 3/4° W 50
- H-13) 1987 J.L. Wilcox LCRC, Liber 3, page 418, survey in Section 3, T23N, R10W, set 1/2" Iron and cap by doubling over 1/8th line occupation East and West of found section corners, corner falls ±4' South centerline East-West road and in line with fences North-South, N 23°E 42" Maple 51.65', N 19° W 18" Maple 29.34', S 17° W 40" maple 24.28', N 50° E 8" Red Pine 75.23'
- H-13) 1992 Wade-Trim/Granger Certificate of Survey, Liber 72, page 143, Found 1/2" Iron


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" Iron and cap #14102 ±4' South centerline East-West and opposite fence lines North-South. This corner is accepted as a careful and faithful reestablishment of the position of the original corner, being the 1/4 corner common to Section 34, T24N, R10W and Section 3, T23N, R10W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 36" iron with Wexford County brass cap stamped S 1/4 34, 1994, PS 33989

- N 50°E - 75.35' - 8" Red Pine
- N 19° W - 29.33' - 18" Maple
- N 23° E - 51.75' - 48" Maple
- S 17° W - 24.23' - 40" Maple

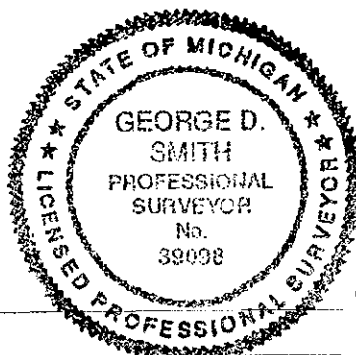

Peer Group Reviewed and Approved

Date: 11-21-94
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

Signed by George D. Smith
Surveyor's Michigan License No. 39098

Date 11/17/94