

APR 25 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED

1994 DEC -9 PM 4: 24

Linda Doughmiller
WEXFORD COUNTY, MI
REGISTERED CLERK

For corners in

Wexford
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 24N R 10W M-6
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property in Sec. S _____ T _____ R _____

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, George D. Smith, in a field survey on June 14, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-6) 1838 GLO Quarter Section post by John Brink, Deputy Surveyor, Beech 10 diameter Quarter Section corner
- M-6) 1981 Wilcox LCRC, Liber 03, page 257: Set Wexford County monument by single proportionate measure between, found NE corner Section 13 and found NE corner Section 25, in centerline road opposite old fence East, fence post S 80° W 32.24, fence post N 50° W 34.40, 6" Red Pine S 55° E 78.55, 4" Red Pine S 39° E 86.09
- M-6) 1985 Wilcox Certificate of Survey, Liber 2, page 147: Found Wexford County monument

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Wexford County monument in good condition in centerline roads North-South and 9' Northerly of fence to West. This corner is accepted as a careful and faithful reestablishment of the position of the original corner, being the 1/4 corner common to Section 13, T24N, R10W and Section 18, T24N, R9W.

Peer Group Reviewed and Approved


Date: 12-9-94
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Wexford County monument with aluminum cap

- S 75° W - 32.40' - Corner fence post
- N 55° W - 34.40' - Fence post
- S 57° E - 48.65' - 10" Red Pine
- S 41° E - 85.91' - 8" Red Pine

LIBER **004** PAGE **321**

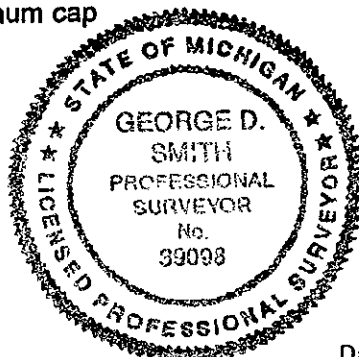

Signed by *George D. Smith*
Surveyor's Michigan License No. 39098

Date 12/2/94