

APR 25 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

1994 DEC -9 PM 2: 58

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in WEXFORD

Linda Loughmiller WEXFORD COUNTY, MI REGISTER OF DEEDS

Table with columns: (County), Located In, Corner Code. Rows include Public Land Survey, Property Controlling in Section, Miscellaneous Property in Sec.

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

CRAIG J. PULLEN

AUGUST 17

94

I, in a field survey on , 19 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-M and rows 2-13. Contains numbers 1-36.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- H-13 1838 GLO SURVEY BY J. BRINK WOOD POST SUGAR 10 N28E 40 SUGAR 9 N27W 44
1896 & 1899 SURVEY IN SEC.3, T23N, R11W BY DEVOE AND ALDERMAN IN TEED SURVEY BOOK L.1 P.298 STAKE NO WITNESSES GIVEN. DISTANCES OF N. LINE SEC.3 SHOWN.
1913 FARGO ENGINEERING SURVEY IN SEC.34, T24N, R11W NO U.S. EVIDENCE. PRORATION TO GLO SHOWN ACROSS S. LINE SEC.34 SUGAR 10" S80W 0.47 1/2 CH ELM 14" S72 1/2 E 1.46 CH
1973 MDNR SURVEY C. ROSER PS#12028 L.C.R.C. L.2 P.616 RESTORED CORNER PER DEVOE & ALDERMAN SURVEYS OF 1896 AND 1899. CORNER POSITION FITS 1/8 LINE FENCE TO W AND SPLIT OF 66' WD. E-W RD. ROW FENCES. FD. 3/4" FARGO PIPE (BURIED 30") S48°40'W 23.5' FROM COR. AS RESTORED. FARGO SET THEIR CORNER BY S.P. (GLO) IN 1913. DID NOT ACCEPT FARGO COR. SET STD. WEXFORD CO. MON. 27" MAPLE S20°W 129.13' 24" MAPLE S08°E 142.55' 27" MAPLE S66°E 90.35' SET CEDAR POST W/LOC. TAG DUE N. 33' CTR. E-W GR. RD. DUE N. 5'± CTR. GR. RD. S. DUE W 3'±
1976, 1983, 1989 J.L. WILCOX & ASSOC. SURVEYS L.1 P.391, L.1 P.977, L.69 P.312, WEXFORD COUNTY MONUMENT. WITNESSES SAME AS ROSER 1973 WITNESSES.
1989 J.L. WILCOX SURVEY D. SCHRIPSEMA PS#24617 L.69 P.375 FD. DNR MON. NO WITS. GIVEN.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


H-13 FOUND WEXFORD COUNTY MONUMENT 0.8' DOWN 5' S OF CENTERLINE 14 RD. AND 3' E OF CENTERLINE 19 1/2 RD. AND 3 PREVIOUS WITNESSES. THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL RE-ESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER, BEING THE 1/4 CORNER COMMON TO SECTION 34, T24N, R11W AND SECTION 3, T23N, R11W.

Peer Group Reviewed and Approved

Date: 12-2-94
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- H-13 3/4 CORNER SECTION 34, T24N, R11W
WEXFORD COUNTY MONUMENT
S66°E 36" MAPLE 90.48' (NEW NAIL)
S20°W 50" MAPLE 128.90' (NEW NAIL)
S8°E 42" MAPLE 142.55'
N15°W FENCE POST 33.35'

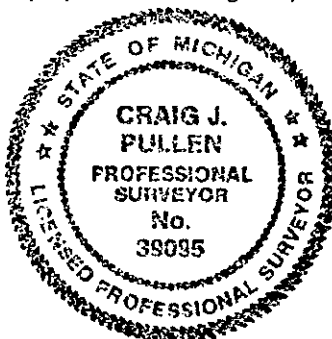

LIBER 04 PAGE 308

Signed by Craig J. Pullen

Date DECEMBER 8, 1994

Surveyor's Michigan License No. 39095