

# LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: \_\_\_\_\_ Located In \_\_\_\_\_ Corner Code # \_\_\_\_\_  
 Wexford \_\_\_\_\_ (County) \_\_\_\_\_

1. Public Land Survey	T	24N	R	11W	E9
	T		R		
2. Property Controlling in Section	S	T	R		
	S	T	R		
3. Miscellaneous Property in Section	S	T	R		
	S	T	R		

4. Lot No: \_\_\_\_\_ Recorded Plat: \_\_\_\_\_  
 5. Private Claims: \_\_\_\_\_

1. Craig W. McVean, in a field survey on May 13, 2003 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

Register of Deeds Stamp & File Number

**A. Description of original monument and accessories and/or subsequent restoration:**


- E9 - GLO - Set Post - J. Brink - 1839  
 Hemlock 17" N65°W 30 L.  
 Hemlock 10" S69°W 15 L.
- Fargo Eng. - 1913 - Found stake set there several years ago by Mr. DeVoe. Also point of older stake beside it-but no US evidence. Found very old blazed line running N-S from corner. Set iron pipe with crockery. Maple 16" N53°W 45½ L.; Hemlock 12" N17½°E 76½ L.
- LCRC - L. 4, p. 60 and Rec. Sur. L. 69, p. 429 - J. A. Ray - 1990  
 Found 1" pipe & butter dish - Set Wexford Co. monument - S17°E 6" Maple 14.20'; S78°W 6" Maple 30.10'; N25°W 8" R. Pine 39.50'; S75°E 12" Cherry 39.57'; South CL. E-W Rd. 32'.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- E9 - Sec. Cor. Common to Sec. 20, 21, 28 & 29 - Found 4" Wexford Co. Alum. Cap monument with ¾" I.D. Fargo pipe on S. side per Ray LCRC. Fargo BT's are gone. CL. of E-W 2-track is 32' S. Measured E 150' ± (181' - GLO) to 2± wide stream coarse SE (stream 3 L. C. SSW - GLO). Wexford Co. monument accepted as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- E9 - 4" Wexford Co. Alum. Cap monument - Add stamping "S201S21" S291S28  
 Set Blue Carsonite Post 1'N  
 S17°E 14.23' to Fd. Nail in W. side 11" R. Maple (JAR)  
 S78°W 29.97' to Fd. Nail in S. side 1w. 9" S. Maple (JAR)  
 N24°W 39.41' to Fd. Nail in W. side 12" R. Pine (JAR)  
 S72°E 39.51' to Fd. Nail in NW side 14" Cherry (JAR)  
 NW 1,4' to Fd. Steel fence post

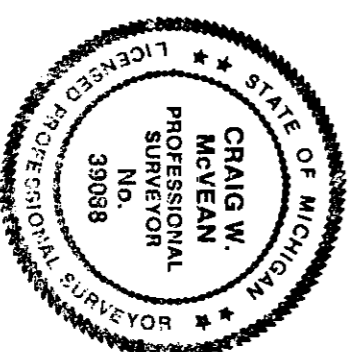

Signed by: Craig W. McVean Date: 11/10/2003  
 Surveyor's Michigan License No.: 39088