

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 12 W.	E-7; F-7; G-7
2. PROPERTY CONTROLLING IN SECTION 16	T. 24 N. R. 12 W.	3
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 27, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original corner and accessories established or restored by subsequent restoration.~~

C. (CONTINUED)

3
Set 1"x36" pipe & cedar post w/loc. tag
8" Maple S40°E 37.5
10" Maple S81°W 41.7
9" Maple N11°W 24.0
12" Maple N43°E 24.2

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-7 Restored sec. corner at prorated distance to S line of Sec. 17 & S line of Sec. 16, betwn. the S $\frac{1}{4}$ corners of Sec. 16 & 17. Lat of sec. cor. estab. by mean of *projection* W across SE & S $\frac{1}{4}$ Sec. 16 & projection E across SW & S $\frac{1}{4}$ Sec. 17. Restoration by this method agrees well w/corner position as restored by Walter Johnson in 1916 in his surveys in Sec. 16 & 20; notes in large red liber at Wexford Co. Road Commission.
 - F-7 Fd. old strap iron & wood posts & one witness from survey of S line Sec. 16, by Walter Johnson in 1916. Corner is 3'± S of ctr. of E-W gravel rd. & in line w/old fence to N.
 - G-7 Fd. 5/8" rerod. Fits 1916 Walter Johnson Wit. to Twp. Hall within 3'.
- 3 Established 1/16 corner per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-7	F-7	G-7
Set std. Wexford Co. Mon. & cedar post	Set std. Wexford Co. Mon.	Set std. Wexford Co. Monument
18" B.Cherry N09°W 8.9	16" B.Cherry S21°E 43.27	24" Maple S77°W 87.25
24" B.Cherry S79°E 23.9	18" B.Cherry N33°E 31.31	30" Maple N71°W 65.30
14" B.Cherry S19°W 12.2	18" B.Cherry N46°W 67.35	NW Cor.Twp.Hall S19°E 88.6
Highly irreg. fence remains in gen. vicinity of this corner	Set cedar post w/loc. tag	Set cedar post w/loc. tag
	Due S 33'	N45°W 47'

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

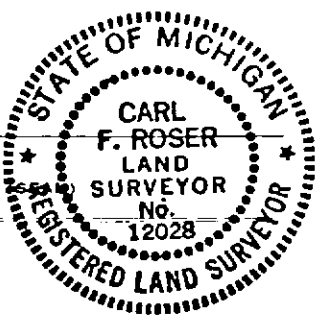

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

WEXFORD TOWNSHIP
WEXFORD COUNTY