

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. 24 N. R. 12 W. ●	A-3
2. PROPERTY CONTROLLING IN SECTION 6_____	T. 24 N. R. 12 W. ●	5; 6; 7
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 22, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and recovery and of subsequent restoration~~

C. (CONTINUED)

7

Fd. well pt. & set cedar post w/loc. tag		
14" Maple	N02°E	29.4
7" Ironwood	N34°E	22.5
10" Maple	N88°E	8.7
10" Maple	S27°E	6.3

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-3 Fd. 3/8" pipe in center of old N-S twp. road grade. Fd. corner fits 3 witnesses from Walter Johnson survey of Sec. 6 dated 1916. Records in large red liber pages 212 & 213, Wexford County Road Commission.
- 5 Recovered 1 1/2" pipe with fence remains N & E that fits Walter Johnson survey of Sec. 6 in 1916.
- 6 Restored well pt. for 1/8 corner that had been bladed out by corner fence post bottom (fence remains W & S), which fits Johnson survey of Sec. 6, dated 1916.
- 7 Recovered old well pt. at old corner fence post (fence N-S-W) that fits Walter Johnson survey of Sec. 6, dated 1916.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-3	5	6
Fd. 3/8" pipe & add 1 1/4"x20" iron rod	Fd. 1 1/4" pipe set cedar post w/loc. tag	Reset well pt. buried in S'y edge of trail & set cedar post w/loc. tag
9" Maple N55°E 25.2	16" Cherry S58°E 48.5	5" Maple N76°W 9.9
8" Maple S52°E 11.9	15" Cherry S26°W 11.2	3" Maple N33°E 45.5
12" Maple S27°W 22.5	9" Maple N43°W 25.4	4" Maple S23°W 45.3
6" Cedar N17°E 24.1	7" Maple N08°E 11.3	
Set Ced. Post w/Loc. Tag Due E 33'		


SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

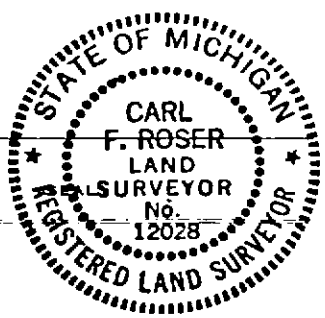

WEXFORD COUNTY
WEXFORD TOWNSHIP

SURVEYOR'S MICHIGAN REGISTRATION NO. _____