

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 24 N. R. 12 W.	B-2; C-2
2. PROPERTY CONTROLLING IN SECTION 6.....	T. 24 N. R. 12 W.	10; 15
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 21, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument or mark and of subsequent restoration~~

C. (CONTINUED)

15

Set 1"x60" Pipe & cedar post w/loc.tag	
9" Maple	N25°W 43.0
5" Cedar	N40°E 24.6
7" Maple	S18°E 37.2
7" Maple	S89°W 47.5
Ctr. 30" Tamarack	
	S49°E 87.6

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-2 Restored center of Sec. 6 at prorated distances to Walter Johnson survey of Sec. 6, dated 1916. Double proportion between fd. 1/16 corners to N-E-W & fd. 1/4 corner to S.
- C-2 Recovered well pt. at old corner fence post (fence N-S-W). Fits survey of Sec. 5 by C.P. Tuller in 1899 & survey of Sec. 6 by Walter Johnson in 1916.
- 10 Established 1/16 corner equidistant & on line between fd. 1/4 corner to N & fd. section corner to S. Corner falls in center of N-S dirt trail road. A 3/4" rod is N50°E, 20.5'.
- 15 Established 1/16 corner on line between fd. 1/4 corner to E & fd. section corner to W & at prorated distance to G.L.O. survey.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-2	C-2	10
Set 1 1/4"x36" pipe & cedar post w/loc. tag	Set std. Wexford Co. Mon. & cedar post w/loc. tag	Drove 1 1/4"x20" rod
3" R. Pine S29°E 35.1	14" Maple N23°E 36.0	12" Maple S20°E 32.2
3" R. Pine S55°W 11.0	14" Maple N78°W 30.2	9" Maple S73°E 50.2
4" R. Pine N13°W 31.0	16" B. Cherry S52°W 39.8	14" Maple N54°E 22.3
E-W Random Due S 1.5	10" Maple S02°W 19.4	10" Maple N13°E 69.8
		Set cedar post w/loc. tag
		Due E 16.5

SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

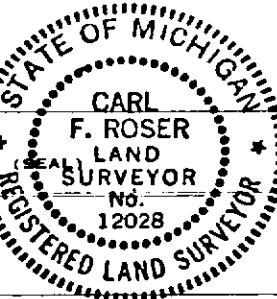

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

WEXFORD TOWNSHIP
WEXFORD COUNTY