

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 12 W.	A-6; A-7
2. PROPERTY CONTROLLING IN SECTION	18 T. 24 N. R. 12 W.	15
3. MISCELLANEOUS PROPERTY IN SECTION	18 T. 24 N. R. 12 W.	YY (1977.51 W of B-7 § 656.31 E of A-7)
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 22, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on June 22, 1976, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A - Description of original monument and accessories and of subsequent restoration:

C. (CONTINUED)

	YY	
Drove 1 1/4" x 18" Rod		
6" R. Pine	N09°E	59.93
15" Walnut	N70°E	65.56
26" Maple	S71°E	141.50
Set cedar post w/loc. tag	Due N	33'
Fence to N	Due W	1'
Ctr. E-W gravel rd.	Due S	6'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-6 Found 2 1/2" shaft in center of N-S road with old fences to E & W. Fits J. H. Millard survey of Section 13, T. 24 N., R. 13 W., 1903. \*
- A-7 Found 1/2" pipe w/cap in blacktop road; road intersection N-S-E-W. \*
- 15 Established 1/16 corner at prorated distance to G.L.O. & on line between section corner W & 1/4 corner E. Corner is in line with fence to S.
- YY Established SW corner of E 1/2 frl. W 1/2 frl. SW 1/4 of Section 18 as noted in item 3, code YY above.

\* Cor. of rec. at Manistee Co. Reg. of Deeds, R.L.S. #13030, Glenn DeLaMater, 7-14-75.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-6	A-7	15
Set std. Wexford Co. Monument	Found 1/2" pipe	Drove 1 1/4" x 18" Rod
3" S. Pine S50°E 67.97	△ FAS Mon. S47°W 47.0	7" R. Pine N60°W 85.94
4" Spruce S60°W 59.76	4" S. Pine N63°E 87.60	6" R. Pine N62°E 87.83
Power Pole N89°W 98.56	Set cedar post w/loc. tag	32" Cherry S02°W 84.90
Set cedar post w/loc. tag	N45°E 60'	Set cedar post w/loc. tag
Due E 33'		Due N 33'
		Ctr. E-W gravel rd. Due S 6'

SIGNED BY Carl F. Roser 4-28-77 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

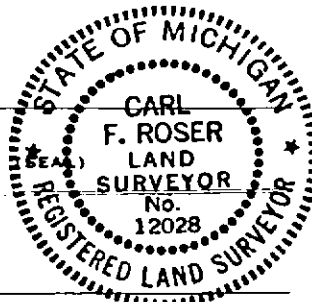

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ WEXFORD TOWNSHIP  
WEXFORD COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET