

MAY 09 1996

copy -

COMMISSION

REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Washtenaw</u> (county)	Located In:	Corner Code #
1. Public Land Survey	T 3S R 3E	K11
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____	Recorded Plat _____	
5. Private Claims _____		

REGISTERED
 WASHTEENAW COUNTY, MI
 MAR 29 1 31 PM '96
 COUNTY CLERK/REGISTER
 -COPY-
 Register of Deeds Stamp & File Number

I, R.T. Tietsema, in a field survey on May 31, 1995, do hereby certify that under the requirements of P.A.74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with the regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management of by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate

A. Description of original monument and accessories and/or subsequent restoration:

1815	GLO (Wampler)	Fld. Notes	Set Original Corner	1) 10" W. Oak 2) 20" Y. Oak	S67E S54W	28 links (18.48') 77 links (50.82')
			Set Corner for Sections 25,26,35, & 36			

(Continued on back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" Iron in monument box at intersection of M-52 and Bethel-church Road
 Also found remaining witnesses:

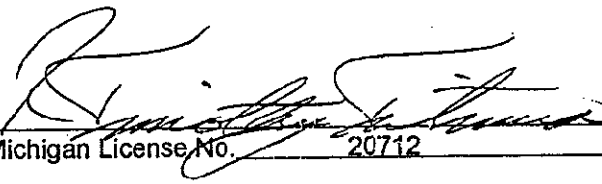
3) Centerline of pavement (M-52)	East	3.0"
6) SE Corner of House	N27W	120.38'
7) 30" Oak	S10W	94.41'
8) 18" Locust	N60E	118.97'
11) 30" Spuce	N10W	105.40'
13) U. Pole	S45E	98.03'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Remonumentation Cap
 Set additional accessories:

3) Centerline of pavement (M-52)	East	3.0"	
6) SE Corner of House	N27W	120.38'	
7) 30" Oak	S10W	94.41'	to nail & R.T.
8) 18" Locust	N60E	118.97'	to nail & R.T.
11) 30" Spuce	N10W	105.40'	to nail & R.T.
13) U. Pole	S45E	98.03'	to nail & R.T.

It is our opinion that this corner represents the original corner and in accepted as the best available evidence of the position of the original corner.

Signed by  Date 11 Dec. 95
 Surveyor's Michigan License No. 20712

- Copy 5

Section A continued

Date	Owner	Address	Boundary	Foundation	Witnesses	Measurements	Notes
7/1/1967	Atwell-Hicks			Fnd. 1/2" Rerod Reset with 3/4" IP	3) Centerline Asphalt 4) 10" Juniper N25W 5) 14" Pear N50W 6) SE Corner Hse. N30W 7) 20" Oak S15W 8) 12" Tree N70E	East 3.0' 48.03' 47.3' 120.40' 94.46' 118.8'	
22/70	Atwell-Hicks			Fnd 3/4" Iron Pipe	3) Centerline Asphalt 4) 10" Juniper N25W 5) 14" Pear N50W 6) SE Corner Hse. N30W 7) 20" Oak S15W 8) 12" Tree N70E	East 3.0' 48.03' 47.3' 120.40' 94.46' 118.8'	
12/1971	N.N. Fahrner JOB NO:6588	17620	Boundary		No Witnesses Given		
23/1972	James H. Granger	16041	Boundary	Fnd. 1/2" Iron in Mon Box	1) Center Line M-52 3) 14" Pear N50E 7) 14" Locust S59E	East 3.0' 47.4' 53.7'	
16/1972	James H. Granger	16041	Boundary	Fnd. 1/2" Iron in Mon Box	1) Center Line M-52 3) 14" Pear N50E 7) 14" Locust S59E	East 3.0' 47.4' 53.7'	
16/1977	R.T. Tietsema JOB NO:7-77	20712	Boundary		4) SE Corner Hse. N30W 5) 20" Oak S15W 6) 12" Tree N70E	120.40' 94.46' 118.8'	
19/1979	John L. Snyder JOB NO: 32865	13352 L5P162	Boundary	Fnd. 3/4" Iron Pipe in mon. box	1) Centerline of Pvmnt. East 4) SE Corner Hse N27W 5) 24" Oak S10W 8) 10" Pine N25W 9) 20" Pine N30W	3.0' 120.4' 94.4' 42.0' 105.4'	
0/10/1979	N.N. Fahrner JOB NO:17141	17620 L5P282	Boundary	Fnd. 1" Iron Bar in mon. box	2) 12" Cedar N30W 5) 24" Oak S25W 10) Telephone Pole N65W 11) Power Pole S45E 12) Telephone Pole N65E	48.30' 94.48' to nail 70.77' to nail 97.61' to nail 85.61' to nail	
24/1982	R.T. Tietsema JOB NO:282	20712	Boundary	Fnd. 3/4" Iron Pipe in mon. box	4) SE Corner Hse. N30W 5) 20" Oak S15W 6) 12" Tree N70E	120.40' 94.96' 118.8'	
2/05/1983	R.T. Tietsema JOB NO:9283	17620	Boundary		No Witnesses Given		
3/10/1988	Craig Eckfeld JOB NO:88242	33135	Boundary	Fnd mon. box "X" M-52 and Bethel-Church Rd	5) 24" Oak S16W 9) 24" Pine N30W 12) U. Pole N76E 11) U. Pole S44E	94.37' to nail 105.39' to nail 85.60' to nail 97.96' to nail	
5/1/1986	N.N. Fahrner JOB NO:20593	17620	Boundary	Fnd. 1" Iron Bar in mon. box	4) 12" Cedar N30W 7) 24" Oak S25W 12) Telephone Pole N65W 13) Power Pole S45E 14) Telephone Pole N65E	48.30' 94.48' to nail 70.77' to nail 97.61' to nail 85.61' to nail	
5/28/1993	Charles C. Wilson JOB NO:93042	13604	Boundary	Fnd 1" Iron in mon. box	1) Center line Pvmnt. East 4) SE Corner Hse. N27W 5) 30" Oak S10W 6) 18" Locust N60E 9) 30" Spruce N10W 11) U. Pole S45E	3.0' 120.4' to centerline 94.40' to nail 118.88' to nail 105.4' to centerline 97.79' to nail	

APPROVED

DATE 10/23/95

CO. REP. FX