

SURVEY & REMONUMENTATION

MAR 18 1998

RECORDED
WASHTENAW COUNTY, MI

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JAN 22 8 30 AM '98

For corners in

<u>WASHTENAW</u> (County)	Located in:	Corner Code #
	MANCHESTER TOWNSHIP	
1. Public Land Survey	T <u>4S</u> R <u>3E</u>	<u>I-11</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

PEGGY M. HAINES
COUNTY CLERK/REGISTER

- COPY -

- COPY -

Liber 00002 Page 0007 RM

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, PAUL V. SCHWIMMER, in a field survey on AUG 19, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

TIME RECORDED: 8:30 am
DATE: Jan 22, 1998
PEGGY M. HAINES
WASHTENAW COUNTY CLERK/REGISTER

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

G.L.D. (FEB 4, 1834) SET 1/4 POST
W. DAK 10' N 27'E 20 LINKS (1)
W. DAK 11' S 33'W 12 LINKS (2)

N 21°E 60.5' 24' ELM (3) ROTTED STUMP
S 71°E 60.7' 12' HICKORY (4) (MEAS 60.76')
S 65°E 50.5' 8' HICKORY (5) (GONE)
S 58°E 31.6' 14' HICKORY (6) (MEAS 31.70')
S 34°E 43.4' 12' HICKORY (7) (MEAS 43.42')
S 16°E 79.4' 22' BURR OAK (8) (MEAS 79.62')
S 31°W 38.2' 12' BASSWOOD (9) (MEAS 38.25')
S 78°W 21.2' 14' BASSWOOD (10) (MEAS 21.32')

ON OCTOBER 3RD, 1934, W.J. ARMSTRONG FOUND THIS ORIGINAL POST AND REPLACED IT WITH A 1' X 60' IRON PIPE. HIS NOTES DESCRIBE "FOUND OLD WOOD STAKE. RESET WITH 1' X 60' IRON PIPE, STONES, BRICKS, AND BROKEN TILE."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

ON OCT. 16, 1956, THE FIELD CREW OF GEORGE SNYDER, P.E. OUT OF JACKSON, MICHIGAN RECOVERED ARMSTRONG'S IRON AND RAISED IT BY DRIVING A 1/2" IRON INTO IT. THEY MEASURED THE FOLLOWING WITNESSES)

S 16°E 80.00' 24' B. DAK WITH MSHD TAG (8)
S 71°E 60.4' 16' HICKORY WITH MSHD TAG (4)
S 58°E 31.4' 18' HICKORY WITH MSHD TAG (6)
S 34°E 43.4' 15' HICKORY WITH MSHD TAG (7)
S 31°W 38.3' 18' BASSWOOD WITH MSHD TAG (9)
S 78°W 21.2' 18' BASSWOOD WITH MSHD TAG (10)


WASHTENAW ENGINEERING RECORDED AN ACT 74 (LIBER 4, PAGE 370) FOR I-11 ON DEC. 1ST, 1977. THEY FOUND 6 OF THE ORIGINAL ARMSTRONG WITNESSES AND THE 1' IRON PIPE.
S 71°E 60.7' 12' HICKORY W/ NAIL (4) S 16°E 79.4' 34' BURR OAK W/ NAIL (8)
S 58°E 31.6' 18' HICKORY W/ NAIL (6) S 31°W 38.2' 24' BASSWOOD W/ NAIL (9)
S 34°E 43.4' 16' HICKORY W/ NAIL (7) S 78°W 21.0' 26' BASSWOOD W/ NAIL (10)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

FOUND 1' IRON PIPE WITH ROCKS THAT HAD BEEN RAISED BY A 1/2" (I.D) IRON, I SET A REMONUMENTATION CAP ON THE 1/2" IRON.

S 71°E 60.76' 26' HICKORY W/ NAIL AND REMON TAG IN N. SIDE (4)
S 58°E 31.70' 20' HICKORY W/ NAIL AND REMON TAG IN N. SIDE (6)
S 34°E 43.42' 18' HICKORY W/ NAIL AND REMON TAG IN W. SIDE (7)
S 16°E 79.62' 38' BURR OAK W/ NAIL AND REMON TAG IN W. SIDE (8)
S 31°W 38.25' 28' BASSWOOD STANDING STUMP W/ NAIL AND REMON TAG IN S.E. SIDE (9)
S 78°W 21.32' 26' BASSWOOD STANDING STUMP W/ NAIL AND REMON TAG IN S. SIDE (10)
N 70°W 24.84' 26' ASH W/ NAIL AND REMON TAG IN N. SIDE

THE SELECTED LOCATION IS A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

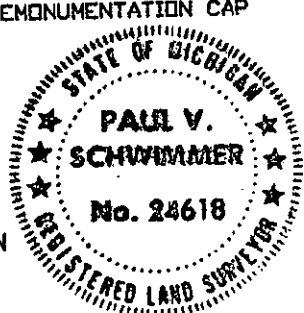

Signed by Paul V. Schwimmer
Surveyor's Michigan License No. 24618

Date Nov 12, 1997

APPROVED
DATE 11/10/97
CO. REP. Kx